

National Property Inspections

	Jo	e C	Client, 3136	5 Any St	ree	t, Any Town ,	USA, 9	9999					
ELECTI	RICAL					□ Mo	nitor Co	ndition	☑ Rec	omme	nd Re	pair	s
SERVICE	SIZE (Main Panel)												
	lt (Nominal)		110 / 220 Vol	lt (Nominal)	$\overline{\mathbf{V}}$	120 / 240 Volt (Nor	ninal) 🗆	60 An	ıp		100	Amp)
□ 125 Am	np		150 Amp			200 Amp		Undet	ermined				
☑ 110 AM	ſΡ		-			•							
SERVICE	SIZE (Sub Panel)												
□ 40 Amp	p		60 Amp			100 Amp		Undet	ermined	l			
SERVICE			Overhead	✓ Undergro	und				ACC	MAR	NI	NP	DEF
ENTRANCE	CABLE		Aluminum	Copper							V		
PANEL			Breaker(s)	☐ Fuse(s)		☐ Combination							\square
SUB-PANEL			p. • • • • •		_	7							<u></u>
סי	oCIn											M	
GFCI(IN PAI	NEL)*											Ø	
ARC FAULT	:											Ø	
SMOKE DET	TECTORS*								V				
☐ Overfuse	d		Double Tapping		□ Rust / Corrosion				☐ Insufficient Access				
☐ Looses C	connections		No Main Disconnect			Fuse / Breakers Incorrectly Sized			Overheating / Scorching				
☐ Improper	Splices		Open Knockou	its		Water Meter Not Jum	pered		Impro	per Gr	ound		
Comments:	*Smoke Detectors /	GFC	'I's checked with	1 test button	only	. Monthly Test Recor	nmended.						
	and ground wire sub-panel from s globe protector of	s are servi on lig	e connected of ce disconnection in the connection in the connectio	on the san ct in main ent closet.	ne b pan Op	panel. Open knock lus bar in sub -pan el. Scorching obse len grounded outle licensed electricia	el. Und erved in et in mas	er-sized sub-pai	l wire f nel. M	eedin	g		





ROOFING					☑ Monitor Condition	ACC	MAR	NI	NP	DEF	
					□ Recommend Repai	rs		Ø			
Age: 10	Year(s)	Des	sign Life: 20-25	Year(s)	Layers: 2		10	00 % V	isible		
□ Visual F	rom Ground		Walked On		Ladder at Eaves		Snow	Covere	ed		
☐ Asphalt / Composition			Wood Shake		Wood Shingle		Tile				
☐ Tar and Gravel			Metal		□ Rolled Composition □		Slate				
□ Membra	ne										
□ Suspecte	ed Leak(s)		Missing Shingle(s)		Cupping/Curling/Lifting/Brittle		Previo	us Rep	airs N	Voted	l

Comments: Leaks not always detectable.

Roof is showing signs of age by granular loss and worn edges of the shingles. Small abrasions noted. Per homeowner a tree fell on the roof during a winter storm. Recommend further evaluation and repair by a qualified roofing contractor.





AIR CONDITIONER

☐ Monitor Condition	ACC	MAR	NI	NP	DEF
☐ Recommend Repairs	Ø				

Brand :	Carrier	Model:	B281988	Size:	2.5 ton

Age: 18 Year(s) Design Life: 20-25 Year(s)

OPERATION									
$\overline{\checkmark}$	Electric		Gas						
\checkmark	Central		Wall		Swamp Cooler				
	Noisy Fan / Compressor		Outside Unit Not Level		Outside Temp Too Cold to Test		Dirty/Damaged Condenser		
	No Pad Under Unit		No Outside Disconnect		Remove Obstructions / Vegetation		Rust / Corrosion		
	At or Near Design Life		Beyond Design Life		Missing/Improper Condensate Line				
	Window Units Not Inspected		Damaged Suction Line		Supected Leak(s) / Clogged Conder	nsate	Line		

□ Temperature Differential Not Within Industry Standards □ Needs Normal Maintenance / Cleaning

Comments:



" Independently Owned and Operated "

Inspection Date: Inspector: John Anyman Email or Web Site: john.anyman@npiweb.com

10/4/2006 Inspector Phone 555-555-555

©1996-2006 Page 25 of 39



National Property Inspections

Joe Client, 3136 Any Street, Any Town, USA, 99999

Summary

This summary is not the entire report. The complete report may include additional information of concern to the client. It is recommended that the client read the complete report.

DRIVEWAY Defective

Front side walk where it meets the approach of the driveway is heaved and crack. Recommend repair/replacement by a qualified concrete contractor.

PORCHES / STOOPS Marginal

Front porch slopes towards house, which causes water to settle towards the house. Since the siding of the home is vinyl and no evidence of water intrusion present, I recco mend monitoring the conditions for future water intrusion issues.

DECKS / BALCONY

Defective

Three steps or more present at deck staircase including deck platform. Recommend installing an appropriate sized handrail for safety. Earth to wood contact at the deck posts. Recommend repairs by a qualified deck contractor

1/2 BATHROOM (BASEMENT)

Defective

GFCI Protection (Checked with Test Button Only. Monthly Test Recommended.)

Defective

Missing GFCI protection in 1/2 bath in basement. Recommend installing GFCI protected outlet by a qualified electrician.

INTERIOR ROOM MASTER BEDROOM

Defective

Electrical (Random sampling of outlets, switches, fixtures.)

Defective

Un-grounded outlet noted in master bedroom North wall. Recommend repair by a qualified electrician.

MAR (MARGINAL)

The item/system was marginally acceptable. (It performed its designed function as of the time of the inspection. However, due to age and/or deterioration, it will likely require early repair or replacement.)

DEF (**DEFECTIVE**)

The item/system failed to operate/perform its intended function, was structurally deficient, was unsafe or was hazardous at the time of the inspection.

" Independently Owned and Operated "

Inspection Date: Inspector: John Anyman Email or Web Site: john.anyman@npiweb.com

10/4/2006 Inspector Phone 555-555-5555

©1996-2006 Page 39 of 39